
## 4-7/8-in. Roller Guides

# **Spare Parts Leaflet 14-6261AD**

August 1, 2018/ Page 1 of 8

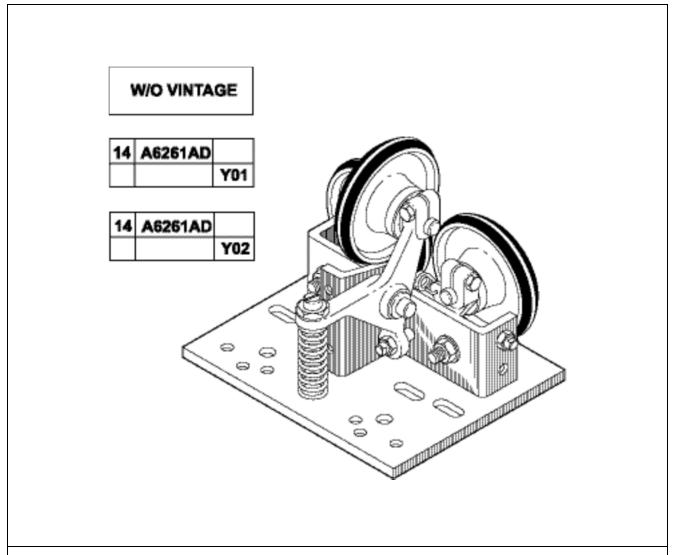

**OTIS** 

This document does not contain any technical data subject to EAR or ITAR

SERVICE ENGINEERING
Otis Elevator Company
Bloomfield, Connecticut USA

Unpublished Work—© Otis Elevator Co.; 2018

## **History**

## **Leaflet Description**

This leaflet provides spare parts information for 4-7/8-inch roller guides.

#### **Leaflet Revisions**

Date Revised	Subject Matter Expert	Reason for Revision
April 1998	Duane Stupienski	New SPL to cover all vintages and record levels of 6261AD-type roller guide.
December 1, 1999	Duane Stupienski	Add vintage 02 information and bushing reaming note.
January 31, 2002	Duane Stupienski	Remove 335E84 bushing as LRU. Instruct user to select appropriate lever with preinstalled bushing.
August 1, 2018	Juan Murillo	Added reference to TIP 18.1-9; Updated document template

#### **Related Drawings**

Drawing No.	Title	Drawing No.	Title
A6261AD	4-7/8 in. Roller Guide Assemblies	6261AD	4-7/8 in. Roller Guide Assemblies
A6261H	4-7/8 in. Roller Guide Assemblies	6261AN	4-7/8 in. Roller Guide Assemblies

#### **Related Documents**

Document ID	Title
SPL 14-A6261AM	10-in. Roller Guides
SPL C-3033	Sliding Guides, Lubricators (formerly Roller Guides)
SU8-102	Counterweight Roller Guides
TIP 18.1-1	A6261H - Failure of Spring Attachment
TIP 18.1-5	Roller Guide Lever Arm Information—Modernization
TIP 18.1-9	Roller Guide Rebuild Kits

#### **Subject Matter Expert**

Name	Department
Juan Murillo	OSC Service Engineering


#### About Spare Parts Leaflets...

This document lists the lowest replaceable units (LRUs) for the standard version of the product. The LRUs are chosen by a team of Otis associates representing engineering and manufacturing.

While goal of this document is to make parts identification as easy as possible, the document cannot be all-inclusive. Elevator and escalator contracts classified as "special" or "custom" are not addressed here. For such contracts, please refer to specified information, the contract folder, TIPs, Field Education Articles, Construction Letters, etc. for further information. If you have any suggestions about this document, please contact the subject matter expert listed on this page.

## **Roller Guide Assemblies**

### 14-6261AD

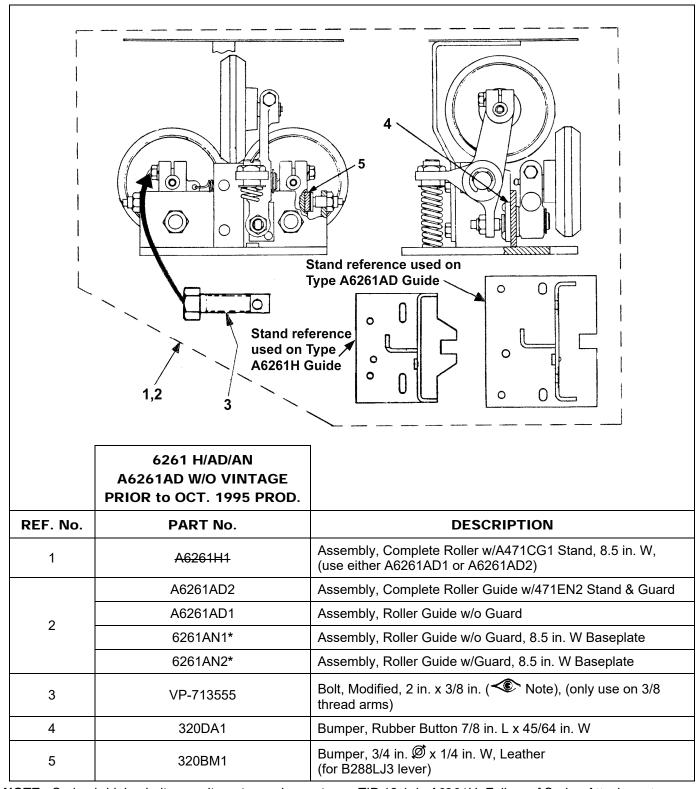


NOTE: Spring bridging bolts are alternate service parts per TIP 18.1-1, A6261H–Failure of Spring Attachment.

**NOTE:** See TIP 18.1-9 for roller guide rebuild kits.

<sup>\*</sup> Special order only.

#### 14-6261AD


# **Roller Guide Components**

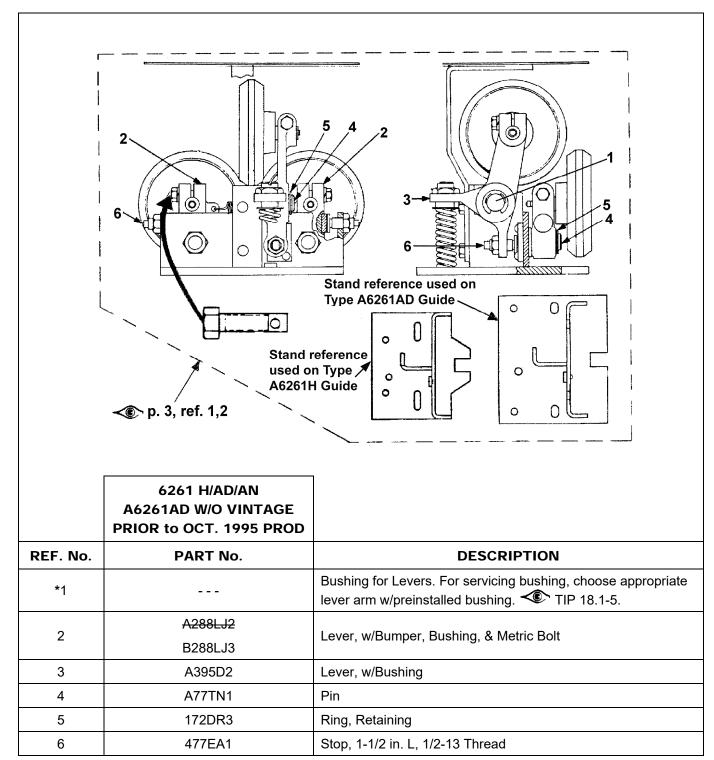

<sup>\*</sup> General location. Part not illustrated.

NOTE: See TIP 18.1-9 for roller guide rebuild kits.


Page 4	August 1, 2018
--------	----------------

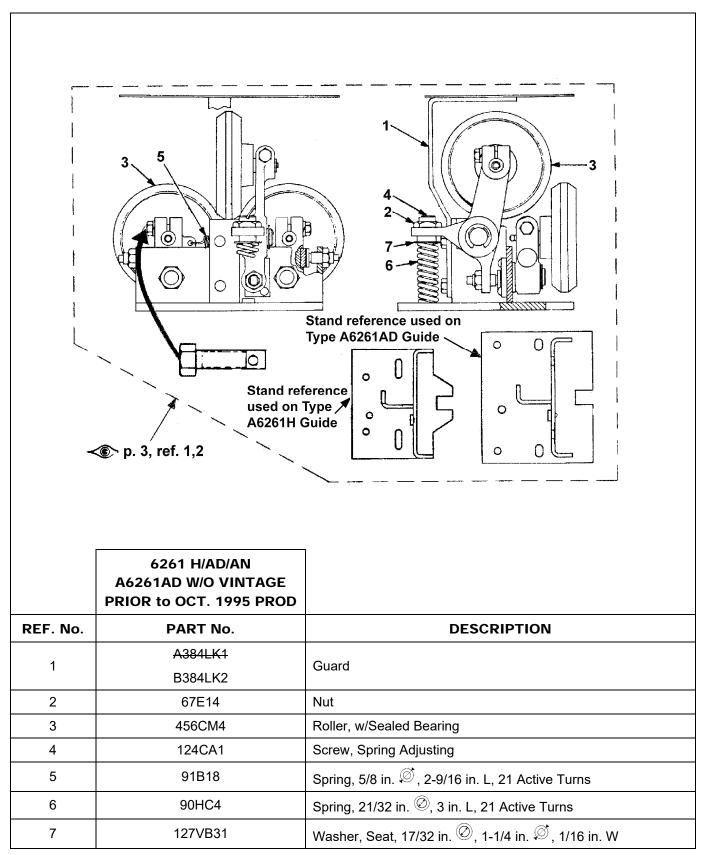

NOTE: See TIP 18.1-9 for roller guide rebuild kits.

## 14-6261AD

## **Roller Guide Assemblies (Metric)**

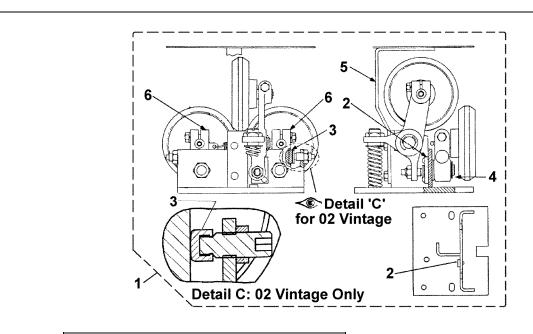

	A6261AD		
	01 VINTAGE POST-OCT. 1995 PROD.	02 VINTAGE POST-FEB. 1999 PROD.	
REF. No.	PART No.		DESCRIPTION
1	A6261AD2		Assembly, Complete Top Roller Guide, 9.8 in. Baseplate, w/Guard
<b>'</b>	A6261AD1		Assembly, Complete Bottom Roller Guide, 9.8 in. Baseplate, w/o Guard
2	320DA1		Bumper, Rubber Button 7/8 in. L x 45/64 in. W
3	320BM1		Bumper, 3/4 in. ② x 1/4 in. W, Leather (for B288LJ2 lever only)
		AAA329BU1	Bumper, Stop, 5/8 in. dia.
*4			Bushing for Levers. For servicing bushing, choose appropriate lever arm w/preinstalled bushing.  TIP 18.1-5.
5	B384LK2		Guard
6	B288LJ2		Lever, w/Bumper & Bushing
6		B288LJ5	Lever, w/Bushing (w/o rubber bumper)


<sup>\*</sup> General location. Part not illustrated.

**NOTE:** See TIP 18.1-9 for roller guide rebuild kits.

Page 6	August 1, 2018
	110.510.01

# **Roller Guide Assemblies (Metric)**

#### 14-6261AD

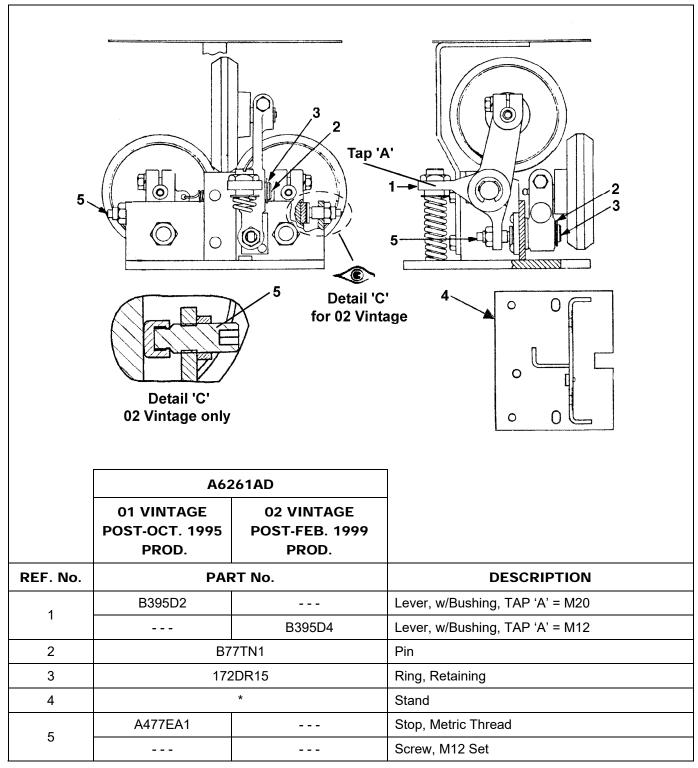


<sup>\*</sup> Part shown for reference only

**NOTE:** See TIP 18.1-9 for roller guide rebuild kits.

#### 14-6261AD

## **Roller Guide Assemblies (Metric)**

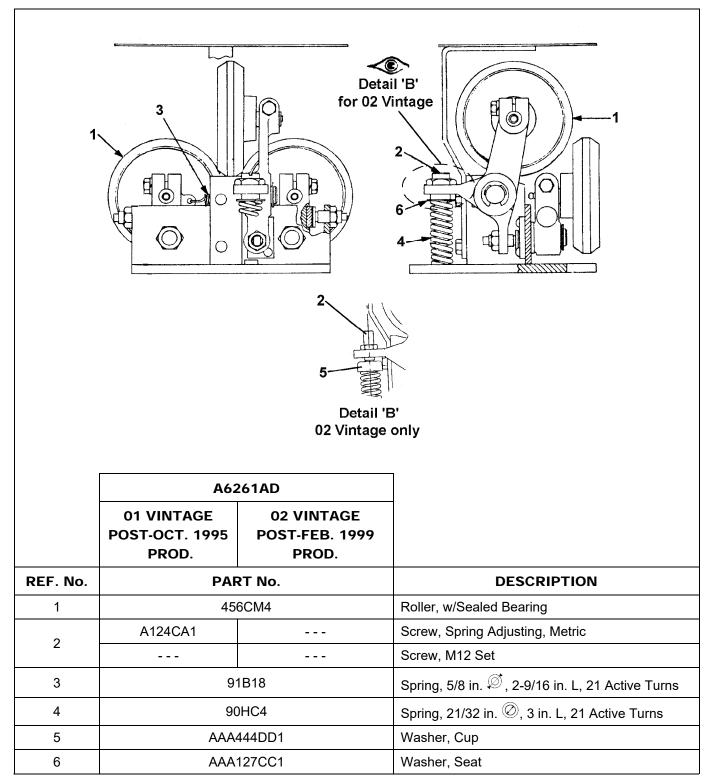

NOTE: See TIP 18.1-9 for roller guide rebuild kits.